

### 050-341

### PRODUCT BRIEF

1-10 GBPS, 10KM

PRINTED CIRCUIT BOARD (PCB) MOUNT SINGLE FIBER BIDI TRANSCEIVER, 1270NM OR 1330NM DFB TRANSMITTER, PIN TIA RECEIVER SMALL & COMPACT WITH RUGGED CONSTRUCTION FOR HARSH ENVIRONMENTS

REV	DESCRIPTION	DATE	APPROVED
14	Update Pictures, 2D Drawing, PRBS31	06/25/2019	YA/HM/RAS
15	Updated Sensitivity to clarify Er Test Conditions, Updated Transmitter Optical Power and Receiver Sensitivity to clarify that Fiber test jumper losses are included and not de-embedded, Corrected OMA Sensitivity, updated description to included 1Gbps performance	1/06/2020	RAS/SZ
16	Clarified notes for Table 4 & Table 5	1/07/2020	RAS/SZ



### PCB Mount Single Fiber BIDI Transceiver, 10 Gbps, 10km, SMF, 3.3V

Glenair 050-341, is a ruggedized harsh environment PCB Mount Transceiver with electrical and optical functionality equivalent to SFP transceivers but with mechanical design that is suited to the harsh temperature and vibration environments found in Military, Aerospace, Railway, Oil and Gas, and Industrial applications. The PCB Mount optical transceivers also support optional Digital Monitoring Interface (DMI) features in accordance with SFF 8472. The Transceiver is comprised of a transmitter section and a receiver section; these both reside on a common package and interface with a host board through a high speed electrical connector. The module contains a Bi-Directional Optical Subassembly (BOSA) terminated to a single GC optical connector, enabling Bi-Directional optical transmit and receive over a single fiber optic cable.



The transmitter section includes the Bi-Directional Optical Subassembly (BOSA) and laser driver circuitry. The BOSA, containing a 1270 nm or 1330nm DFB (Distributed Feedback) laser light source, is located at the optical interface and mates with the GC optical connector. The DFB laser inside the BOSA is driven by a laser driver, which converts differential logic signals into an analog laser diode drive current. This laser driver circuit regulates the optical power at the desired level provided the data pattern is DC balanced (for example 8B10B encoding).

The receiver section includes the same Bi-Directional Optical Subassembly (BOSA) and amplification/quantization circuitry. The BOSA, containing a PIN photodiode and transimpedance preamplifier, is located at the optical interface and mates with the GC optical connector. The BOSA is mated to a limiting amplifier IC that provides post-amplification and quantization. Also included is a Loss Of Signal (LOS) detection circuit.

### **KEY FEATURES/BENEFITS**

- SFP+ Compatible Electrical I/O signal levels
- 1270 nm or 1330 nm DFB lasers to support 1 to 10.3125 Gbps
- 10km SMF Links

GLENAIR, INC.

- PIN PD to support high sensitivity 10.3125 Gbps
- Transceiver is securely mounted with screws to PCB to ensure excellent shock and vibration performance
- High-Speed Electrical plug-in connector eliminates the need for soldering & enables ease of servicing
- Small: Approx. 0.8" x 0.9" x 0.5"
- -40°C to +85°C Operating Case Temperature

1211 AIR WAY ·

- Glenair fiber jumpers connect from transceiver to any Glenair Mil/Aero Fiber Optic Connector Style
- Evaluation fixtures available
- Digital Diagnostic and Monitoring (DMI) based on SFF-8472, enables monitoring of:
  - TX optical power, RX optical power, Laser bias current, Temperature, Supply voltage

### **APPLICATIONS**

- Harsh Environment such as: Airborne, Tactical, Railway, Industrial, Oil and Gas and Shipboard applications
  - o ARINC 818, 10G Ethernet, FC 1x, 2x, 4x, 8x

· FAX: 818-500-9912

HOW TO ORDER Table 1 Part Number Development Options

Part Number	Two Wire Address	Wavelengths	Temperature**	Screw Length** (Mod Code)
050-341	Blank = A2h	-27-D = 1270nm DFB TX, 1330nm RX	Blank = Standard	Blank = Standard -954-xxx = IAW Mod
PCB Mount BiDi	Other Options:	-33-D = 1330nm DFB		Code 954
Transceiver,	C0, C2, C4, C6, C8, CA, CC, CE,	TX, 1270nm RX		
1- 10.3125Gbps	D0, D2, D4, D6, D8, DA, DC, DE			

Example: 050-341C0-27-D

PCB Mount BiDi Transceiver, SMF, 1270nm DFB TX 1330nm RX, Two Wire Address = C0h, Data Rate = 10.3125Gbps, Standard Temperature Range, Standard Screw Length

\*\*Temperature and Screw Length Mod Codes will not be added onto Digital Memory ID (See Table 9)

GLENDALE, CA 91201-2497 · TEL: 818-247-6000

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA



### Ratings and Specifications

### TABLE 2 ABSOLUTE MAXIMUM RATINGS

Parameter	Symbol	Min	Max	Units	Notes
Storage Temperature	Ts	-55	+100	°C	
Supply Voltage	V <sub>cc</sub>	-0.3	3.8	V	VccT & VccR may not differ by more than 0.5V
Relative Humidity	RH	5	95	%	
Two-wire Interface Input Voltage		-0.5	Vcc +0.5	V	
Optical Receiver Input Average Power			0	dBm	

### **TABLE 3 OPERATING CONDITIONS**

Parameter	Symbol	Min	Тур	Max	Units	Notes
Operating Temperature	T <sub>op</sub>	-40		+85	°C	
Supply Voltage	V <sub>cc</sub>	3.135	3.3	3.465	V	
Supply Current	Icc		260	350	mA	Typical @ +85°C
Power Supply Noise (Peak-Peak)	V <sub>cc_ripple</sub>			5	mV	Per SFF-8431 Rev 4.1

### TABLE 4 ELECTRO-OPTICAL CHARACTERISTICS – TRANSMITTER

Parameter	Symbol	Min	Тур	Max	Units	Notes
Optical Output Power, Avg	P <sub>OUT</sub>	-4.5		0	dBm	Fiber Coupled *, 1270nm or 1330nm DFB,10.3125 Gbps
Optical Output Power – OFF CONDITION	P <sub>OUT-OFF</sub>			-30	dBm	
Optical Return Loss Tolerance				12	dB	IEEE 802.3ae Clause 52 Compliant
Extinction Ratio	Er	3.5	5		dB	
Optical Wavelength (050-341-27-D)	$\lambda_{OUT}$	1260	1270	1280	nm	1270nm DFB TX & 1330nm RX
Optical Wavelength (050-341-33-D)	$\lambda_{OUT}$	1320	1330	1340	nm	1330nm DFB TX & 1270nm RX
Spectral Width, rms	Δλ			1	nm	
Side Mode Suppression Ratio	SMSR	30			dB	
Transmitter Differential Input Impedance	Z <sub>IN</sub>		100		Ohms	AC coupled Internally
Differential Input Voltage	Vin_d	180		800	mV <sub>p-p</sub>	CML, 100 ohm

Note: \* Optical Power measured at the end of GC to LC fiber optic test jumper

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

GLENAIR, INC. · 1211 AIR WAY · GLENDALE, CA 91201-2497 · TEL: 818-247-6000 · FAX: 818-500-9912



### Ratings and Specifications (continued)

### TABLE 5 ELECTRO-OPTICAL CHARACTERISTICS - RECEIVER

Parameter	Symbol	Min	Тур	Max	Units	Notes
Sensitivity, BER 10 <sup>-12</sup> , PRBS31, Er=5.5dB	P <sub>IN</sub>			-14.4	dBm	Fiber Coupled *, PIN PD @ 10.3 Gbps,
Receiver Sensitivity (OMA), BER 10 <sup>-12</sup> , PRBS31	P <sub>IN</sub>			-13.9	dBm	Fiber Coupled *, PIN PD @ 10.3 Gbps
LOS Assert Level	LOSA	-30	-19		dBm	@ 10.3 Gbps
LOS Hysteresis	LOS <sub>HYS</sub>	0.5	2.0		dB	
Overload, BER 10 <sup>-12</sup> , PRBS31	P <sub>IN</sub>	+1			dBm	
Optical Wavelength (050-341-27-D)	$\lambda_{IN}$	1320		1600	nm	1270nm DFB TX & 1330nm RX
Optical Wavelength (050-341-33-D)	$\lambda_{IN}$	1200		1280	nm	1330nm DFB TX & 1270nm RX
Receiver Differential Output Impedance	Rout		100		Ohms	AC coupled internally
Differential Output Voltage Swing	Vout_d	300		850	$mV_{p-p}$	CML, 100 ohm

Note: \* Optical Power measured at the end of GC to LC fiber optic test jumper

GLENAIR, INC.

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

· 1211 AIR WAY · GLENDALE, CA 91201-2497 · TEL: 818-247-6000 · FAX: 818-500-9912



### TABLE 6 COMPLIANCE SPECIFICATIONS

CHARACTERISTIC	Standard	Condition	Notes
Mechanical Shock	MIL-STD-810	Para. 516.6, proc. I, 650g	0.9 ms operating
Mechanical Vibration	MIL-STD-810	Para. 514.6, 40g rms	Random, operating
ESD	MIL-STD-883		500V HBM
Flame Resistance	MIL-STD-1344	Method 1012, Cond. B	30 seconds
Damp Heat	MIL-STD-1344	Method 1002.2, Cond. B	10 cycles , 24 hours
Eye Safety	CDRH and IEC-825	Class 1 Laser Product	

### TABLE 7 MATERIAL/FINISH

GLENAIR, INC.

Item	Material/Finish
110111	Material/Fillish
PCB	FR4
PCB flex	FR4 & Polyimide
Railings	Aluminum 6061-T6 per ASTM-B221/B211M or Equivalent
Screws	CRES Type, 302, 303, 304, 305, or 316
Optical Ferrules & Sleeves	Zirconia, Ceramic
Solder type	RoHS compliant Sn95/Sb5 (232°C melting temp) & RoHS compliant Sn96.5/Ag3.0/Cu0.5 (217° melting)

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

· 1211 AIR WAY · GLENDALE, CA 91201-2497 · TEL: 818-247-6000 · FAX: 818-500-9912 **PAGE 5 of 18** E-mail: sales@glenair.com www.glenair.com



### FIGURE 1 - OUTLINE DRAWING CONTINUED (MARKING)

### LABELING:

GLENAIR, INC.

Each unit will be shipped in an antistatic bag. The label on the antistatic bag shall be at a minimum Arial size 10 black font and contain at a minimum the following information:

ANTISTATIC BAG LABEL:

Glenair

Cage Code: 06324 PN: 050-341-XX-D

Rev: X QTY: X J/N: X D/C:X

S/N\*: XXXXXX


\*If QTY is more than 1, there is no S/N

Each unit will be marked, either with a label or laser engraving, as follows:

- 1. Marking font to be Arial, greater than .08 inches in height.
- 2. Minimum Marking on each part will include the following:
  - Glenair
  - Serial number
  - Glenair Part Number

**Example Minimum Marking:** 

GLENAIR SN123456 050-341-27-D

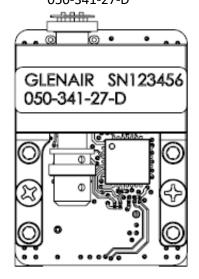


©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

www.glenair.com PAGE 6 of 18 E-mail: sales@glenair.com

1211 AIR WAY · GLENDALE, CA 91201-2497 · TEL: 818-247-6000 · FAX: 818-500-9912



### **FUNCTIONAL DESCRIPTION**

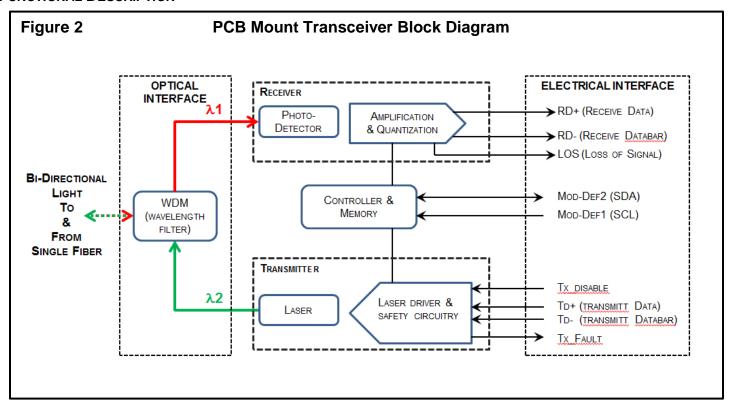

### **TRANSMITTER SECTION**

Transmit Disable (Tx\_Disable)

The transmitter section of the transceiver accepts a TTL and CMOS compatible transmit disable control signal input that shuts down the transmitter optical output. A high signal disables the transmitter while a low signal allows normal transceiver operation. Also laser is disabled when TX\_Disable is open. In the event of a fault (e.g. eye safety circuit activated), cycling this control signal resets the module. Host systems should allow a 10ms interval between successive assertions of this control signal.

Transmit Fault (Tx\_Fault)

A catastrophic laser fault will activate the transmitter signal, TX\_FAULT, and disable the laser. This signal is an open collector output (pull-up required on the host board). A low signal indicates normal laser operation and a high signal indicates a fault. The TX\_FAULT will be latched high when a laser fault occurs and is cleared by toggling the TX\_DISABLE input or cycling the power of the transceiver. The transmitter fault condition can also be monitored via the 2-wire serial interface (address A2, byte 110, bit 2).

www.glenair.com PAGE 7 of 18 E-mail: sales@glenair.com



Eye Safety Circuit

The Transmitter section provides Class 1 eye safety by design and is compliant with US FDA CDRH AEL Class 1 and EN(IEC) 60825-1,2, EN60950 Class 1. The eye safety circuit continuously monitors optical output power levels and will disable the transmitter and assert a TX\_FAULT signal upon detecting an unsafe condition. Such unsafe conditions can be created by inputs from the host board (Vcc fluctuation, unbalanced code) or faults within the module.

### **RECEIVER SECTION**

Receiver Loss of Signal (LOS)

The Loss Of Signal (LOS) output indicates an unusable optical input power level. The post-amplification IC includes transition detection circuitry which monitors the ac level of incoming optical signals and provides a TTL/CMOS compatible status signal to the host. A low LOS logic level indicates the presence of an optical input while a high LOS logic level indicates an unusable optical input. The LOS thresholds are factory-set so that a high output indicates a definite optical fault has occurred (e.g. failed transmitter, broken or disconnected fiber connection to the transceiver, etc.). The LOS can also be monitored via the 2-wire serial interface (address A2h, byte 110, bit 1).

### **FUNCTIONAL I/O**

GLENAIR, INC.

The PCB Mount transceiver accepts industry standard differential signals such as LVPECL and CML within the scope of the SFP MSA. To simplify board requirements, transmitter bias resistors and ac coupling capacitors are incorporated, per SFF-8074i, and hence are not required on the host board. The module is AC-coupled and internally terminated.

Figure 3 illustrates a recommended interface circuit to link the PCB Mount transceiver to the supporting Physical Layer integrated circuits.

The PCB Mount transceiver interfaces with the host circuit board through twenty I/O pins identified by function in Table 8. The transceiver high speed transmit and receive interfaces require SFP MSA compliant signal lines on the host board. The TX\_Disable, TX\_Fault, and RX\_LOS lines require TTL lines on the host board (per SFF-8074i) if used. If an application chooses not to take advantage of the functionality, TX\_Disable need to be tied to GND and TX\_Fault and RX\_LOS do not need to be connected.

### **Digital Diagnostic Interface and Serial Identification (EEPROM)**

The PCB Mount transceiver is compatible with the SFF-8074i SFP specification and with SFF-8472, the SFP specification for Digital Diagnostic Monitoring Interface. Both specifications can be found at http://www.sffcommittee.org.


©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

· TEL: 818-247-6000

· FAX: 818-500-9912





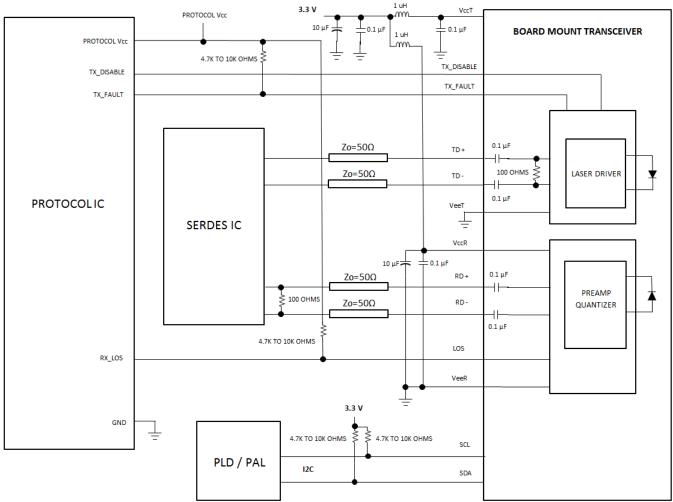

The PCB Mount transceiver features EEPROM for Serial ID, which contains the product data stored for retrieval by host equipment. This data is accessed via the 2-wire serial EEPROM protocol in compliance with the industry standard SFP Multi-Source Agreement. The base EEPROM memory, bytes 0-255 at memory address 0xA0, is organized in compliance with SFF-8074i.

As an enhancement to the conventional SFP interface defined in SFF-8074i, the PCB Mount Transceiver is compliant to SFF-8472 (digital diagnostic interface for optical transceivers). This new digital diagnostic information is stored in bytes 0-255 at memory address 0xA2. Using the 2-wire serial interface defined in the MSA, the PCB Mount Transceiver provides real time temperature, supply voltage, laser bias current, laser average output power and received input power. These parameters are internally calibrated, per the SFF-8472 MSA. The digital diagnostic interface also adds the capability to monitor for Transmitter Faults (TX\_FAULT), and monitor for Receiver Loss of Signal (RX\_LOS). The diagnostic

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

1211 AIR WAY · GLENDALE, CA 91201-2497

GLENAIR, INC.

· TEL: 818-247-6000

· FAX: 818-500-9912



information provides the opportunity for Predictive Failure Identification, Compliance Prediction, Fault Isolation and Component Monitoring.

### Predictive Failure Identification

The predictive failure feature allows a host to identify potential link problems before system performance is impacted. Prior identification of link problems enables a host to service an application via "fail over" to a redundant link or replace a suspect device, maintaining system uptime in the process. For applications where ultra-high system uptime is required, the PCB Mount Transceiver provides a means to monitor two real-time laser metrics associated with observing laser degradation and predicting failure: average laser bias current (Tx\_Bias) and average laser optical power (Tx\_Power).

### **Compliance Prediction**

Compliance prediction is the ability to determine if an optical transceiver is operating within its operating and environmental requirements. The PCB Mount Transceiver provide real-time access to transceiver internal supply voltage and temperature, allowing a host to identify potential component compliance issues. Received optical power is also available to assess compliance of fiber cable plant and remote transmitter. When operating out of requirements, the link cannot guarantee error free transmission.

### Fault Isolation

The fault isolation feature allows a host to quickly pinpoint the location of a link failure, minimizing downtime. For optical links, the ability to identify a fault at a local device, remote device or cable plant is crucial to speeding service of an installation. PCB Mount Transceiver real-time monitors of Tx\_Bias, Tx\_Power, Vcc, Temperature and Rx\_Power can be used to assess local transceiver current operating conditions. In addition, status flag Rx Loss of Signal (LOS) is mirrored in memory and available via the two-wire serial interface.

### Component Monitoring

GLENAIR, INC.

Component evaluation is another use of the PCB Mount Transceiver real-time monitors of Tx\_Bias, Tx\_Power, Vcc, Temperature and Rx\_Power. Potential uses are as debugging aids for system installation and design, and transceiver parametric evaluation for factory or field qualification. For example, temperature per module can be observed in high density applications to facilitate thermal evaluation of systems that incorporate this PCB Mount transceiver

### Required Host Board Components


A power supply noise rejection filter as describe in SFP MSA is required on the host PCB to meet data sheet performance. This is the same filter incorporates an inductor which should be rated 400 mADC and 1  $\Omega$  series resistance or better. It should not be replaced with a ferrite. The required filter is illustrated in Figure 4. Also, the host PCB for the PCB Mount transceiver requires 4.7 K to 10 K $\Omega$  pull-up resistors for TX\_FAULT, LOS, SCA and SDL lines.

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

· TEL: 818-247-6000 · FAX: 818-500-9912

www.glenair.com PAGE 10 of 18 E-mail: sales@glenair.com



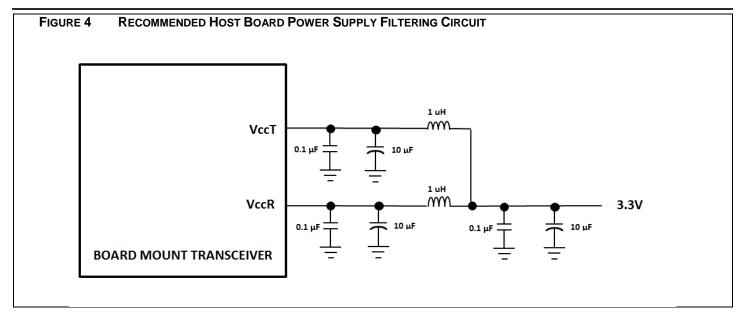

### Fiber Compatibility

GLENAIR, INC.

The transceiver is capable of transmission up to 10km with 9/125 µm SMF at 10.3125 Gbps (10G Ethernet signals).

### Electrostatic Discharge (ESD)

The Transceiver is compatible with ESD levels found in typical manufacturing and operating environments as described JDEC/EIAJESD22-A114-A, Class 1 (<2000Volts) HBM. Glenair recommends that devices are handled with ESD precautions to limit exposure to below 250V HBM.

There are two design cases in which immunity to ESD damage is important. The first case is during handling of the transceiver prior to insertion to the host board. To protect the transceiver, it's important to use standard industry ESD handling precautions. These precautions include using grounded wrist straps, work benches, and floor mats in ESD controlled areas. The ESD sensitivity of the Glenair PCB Mount transceiver is compatible with typical industry production environments.

The second case to consider is static discharges to the exterior of the host equipment after installation, in which case the transceiver may be subject to system-level ESD requirements.

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

www.glenair.com PAGE 11 of 18 E-mail: sales@glenair.com

· TEL: 818-247-6000

· FAX: 818-500-9912



### **Application Support**

GLENAIR, INC.

To assist in the transceiver design and evaluation process, Glenair offers the following aids:

- Evaluation board & Product Manual, part number 050-329, which facilitates in the testing of the PCB Mount transceiver.
- 3D Step file to support modeling of mechanical fit and routing
- PADS schematic and PCB layout library files that can be exported into customer's PCB software design program
- Applications Aid Example of PCB layout including details of high speed transmission designs

### **Customer Manufacturing Processes**

This module is mounted with screws and interfaces with a high-speed low cost surface mount electrical connector residing on the host PC board. The PCB Mount transceiver is not designed for aqueous wash, IR reflow, or wave soldering processes and should be mounted on the host board after host PC board has been through its assembly process.

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

1211 AIR WAY GLENDALE, CA 91201-2497 TEL: 818-247-6000 FAX: 818-500-9912

www.glenair.com PAGE 12 of 18 E-mail: sales@glenair.com



· FAX: 818-500-9912

TABLE 9 TWO-WIRE INTERFACE ID: DATA FIELDS – ADDRESS A01	- Address A0H	DATA FIELDS -	TWO-WIRE INTERFACE	TABLE 9
--	---------------	---------------	--------------------	---------

Byte	#	Data	Byte	#	Data
Decimal	Hex	Notes	Decimal	Hex	Notes
0	80	Glenair PCB Mount Transceiver	37	00	Vendor OUI (NOT USED)
1	04	Serial ID Module Definition	38	00	Vendor OUI (NOT USED)
2	80	"GC" Fiber Optic Connector	39	00	Vendor OUI (NOT USED)
3	20	10G BASE-LR	40	30	"0" Vendor Part Number ASCII character (Note 5)
4	00		41	35	"5" Vendor Part Number ASCII character (Note 5)
5	00		42	30	"0" Vendor Part Number ASCII character (Note 5)
6	01		43	2D	"-" Vendor Part Number ASCII character (Note 5)
7	00		44	33	"3" Vendor Part Number ASCII character (Note 5)
8	00		45	34	"4" Vendor Part Number ASCII character (Note 5)
9	00		46	31	"1" Vendor Part Number ASCII character (Note 5)
10	00		47	43	"C" Vendor Part Number ASCII character (Note 5)
11	06	Compatible with 64/66B encoded data	48	30	"0" Vendor Part Number ASCII character (Note 5)
12	67	BR, 10.3125 Gbps	49	2D	"-" Vendor Part Number ASCII character (Note 5)
13	00		50	32	"2" Vendor Part Number ASCII character (Note 5)
14	0A	10GBASE-LR 10km	51	37	"7" Vendor Part Number ASCII Character (Note 5)
15	64	10GBASE-LR 10km	52	2D	"-" Vendor Part Number ASCII Character (Note 5)
16	00		53	44	"D" Vendor Part Number ASCII Character (Note 5)
17	00		54	20	" " Vendor Part Number ASCII Character (Note 5)
18	00		55	20	" " Vendor Part Number ASCII Character (Note 5)
19	00		56	20	" " Vendor REV Level ASCII Character (Note 5)
20	47	"G" Vendor NAME ASCII Character	57	20	" " Vendor REV Level ASCII Character (Note 5)
21	4C	"L" Vendor NAME ASCII Character	58	20	" " Vendor REV Level ASCII Character (Note 5)
22	45	"E" Vendor NAME ASCII Character	59	20	" " Vendor REV Level ASCII Character (Note 5)
23	4E	"N" Vendor NAME ASCII Character	60	05	Hex Byte of Laser Wavelength (Note 6)
24	41	"A" Vendor NAME ASCII Character	61	1E	Hex Byte of Laser Wavelength (Note 6)
25	49	"I" Vendor NAME ASCII Character	62		RESERVED
26	52	"R" Vendor NAME ASCII Character	63		Check sum code for ID fields 0-62 (Note 7)
27	20	" " Vendor NAME ASCII Character	64	00	
28	20	" " Vendor NAME ASCII Character	65	1A	Hardware TX_Disable, TX_Fault, & LOS
29	20	" " Vendor NAME ASCII Character	66	00	
30	20	" " Vendor NAME ASCII Character	67	00	
31	20	" " Vendor NAME ASCII Character	68-83		Serial Number, ASCII (Note 8)
32	20	" " Vendor NAME ASCII Character	84-91		Date Code (Note 9)
33	20	" " Vendor NAME ASCII Character	92	68	Diagnostic Monitoring, Internal Cal, Rx Pwr Avg.
34	20	" " Vendor NAME ASCII Character	93	В0	Enhanced Options
35	20	" " Vendor NAME ASCII Character	94	05	SFF-8472 rev 11.0
36	00		95		Checksum for bytes 64-94 (Note 7)
			96-255	00	, , ,

### Notes

GLENAIR, INC.

- 1. FC-PI speed 100 MBytes/sec is a serial bit rate of 1.0625 GBit/sec.
- 2. RESERVED
- 3. RESERVED
- 4. RESERVED.
- 5. Table 1, Part number options/extensions. Temperature and Screw Length Mod Codes will not be added onto Digital Memory ID.
- $6. \ Laser \ wavelength \ is \ represented \ in \ 16 \ unsigned \ bits. \ The \ hex \ representation \ of \ 1310 nm \ is \ 051E.$
- 7. Addresses 63 and 95 are checksums calculated per SFF-8472 and SFF-8074, and stored prior to product shipment.
- 8. Addresses 68-83 specify the module's ASCII serial number and will vary by unit.
- 9. Addresses 84-91 specify the module's ASCII date code and will vary according to manufactured date-code.

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

www.glenair.com PAGE 13 of 18 E-mail: sales@glenair.com

1211 AIR WAY · GLENDALE, CA 91201-2497 · TEL: 818-247-6000



FAX: 818-500-9912

Table 10	Two-Wire interface ID: Data Fig	elds – Address A2h is standard	<ul> <li>other options available</li> </ul>	, see part number development

Byte #	Data	Byte #	Data	Byte #	Data
Decimal	Notes	Decimal	Notes	Decimal	Notes
0	Temp H Alarm MSB (Note 1)	26	TX Pwr L Alarm MSB (Note 4)	104	Rx Pavg MSB (Note )
1	Temp H Alarm LSB (Note 1)	27	TX Pwr L Alarm LSB (Note 4)	105	Rx Pavg LSB (Note 1)
2	Temp L Alarm MSB (Note 1)	28	TX Pwr H Warning MSB (Note 4)	106	Reserved
3	Temp L Alarm LSB (Note 1)	29	TX Pwr H Warning LSB (Note 4)	107	Reserved
4	Temp H Warning MSB (Note 1)	30	TX Pwr L Warning MSB (Note 4)	108	Reserved
5	Temp H Warning LSB (Note 1)	31	TX Pwr L Warning LSB (Note 4)	109	Reserved
6	Temp L Warning MSB (Note 1)	32	RX Pwr H Alarm MSB (Note 5)	110	Status/Control
7	Temp L Warning LSB (Note 1)	33	RX Pwr H Alarm LSB (Note 5)	111	Reserved
8	Vcc H Alarm MSB (Note 2)	34	RX Pwr L Alarm MSB (Note 5)	112	Flag Bits
9	Vcc H Alarm LSB (Note 2)	35	RX Pwr L Alarm LSB (Note 5)	113	Flag Bits
10	Vcc L Alarm MSB (Note 2)	36	RX Pwr H Warning MSB (Note 5)	114	Reserved
11	Vcc L Alarm LSB (Note 2)	37	RX Pwr H Warning LSB (Note 5)	115	Reserved
12	Vcc H Warning MSB (Note 2)	38	RX Pwr L Warning MSB (Note 5)	116	Flag Bits
13	Vcc H Warning LSB (Note 2)	39	RX Pwr L Warning LSB (Note 5)	117	Flag Bits
14	Vcc L Warning MSB (Note 2)	40-45	Reserved	118	Reserved
15	Vcc L Warning LSB (Note 2)	56-94	External Cal Constants (Note 4)	119	Reserved
16	Tx Bias H Alarm MSB (Note 3)	95	Checksum for bytes 0-94	120-122	Reserved
17	Tx Bias H Alarm LSB (Note 3)	96	Temperature MSB (Note 1)	123	Reserved
18	Tx Bias L Alarm MSB (Note 3)	97	Temperature LSB (Note 1)	124	Reserved
19	Tx Bias L Alarm LSB (Note 3)	98	Vcc MSB (Note 2)	125	Reserved
20	Tx Bias H Warning MSB (Note 3)	99	Vcc LSB (Note 2)	126	Reserved
21	Tx Bias H Warning LSB (Note 3)	100	TX Bias MSB (Note 4)	127	Reserved (Note 8)
22	Tx Bias L Warning MSB (Note 3)	101	TX Bias LSB (Note 4)	128-247	Customer Writable (Note 9)
23	Tx Bias L Warning LSB (Note 3)	102	TX Power MSB (Note 4)	248-255	Vendor Specific
24	TX Pwr H Alarm MSB (Note 4)	103	TX Power LSB (Note 4)		
25	TX Pwr H Alarm LSB (Note 4)				

### Notes

GLENAIR, INC.

- 1. Temperature (Temp) is decoded as a 16 bit signed twos compliment integer in increments of 1/256 °C.
- 2. Supply voltage (VCC) is decoded as a 16 bit unsigned integer in increments of 100  $\mu V. \,$
- 3. Laser bias current (Tx Bias) is decoded as a 16 bit unsigned integer in increments of 2  $\mu$ A.
- 4. Transmitted average optical power (Tx Pwr) is decoded as a 16 bit unsigned integer in increments of 0.1  $\mu$ W.
- 5. Received average optical power (Rx Pwr) is decoded as a 16 bit unsigned integer in increments of 0.1  $\mu$ W.
- 6. Bytes 55-94 are not intended from use but have been set to default values per SFF-8472.
- 7. Bytes 95 is a checksum calculated (per SFF-8472) and stored prior to product shipment.
- 8. Byte 127 accepts a write but performs no action (reserved legacy byte).
- 9. Bytes 128-247 are write enabled (customer writable).

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

1211 AIR WAY · GLENDALE, CA 91201-2497 · TEL: 818-247-6000



TABLE 11 TRANSCEIVER DIGITAL DIAGNOSTIC MONITOR CHARACTERISTICS (WHEN APPLICABLE)

PARAMETER	Symbol	Min.	Units	Notes
Transceiver Internal Temperature				Temperature is measured internal to the transceiver and is valid
Accuracy	TINT	±3.0	°C	from
				-40°C to +85 °C case temperature
Transceiver internal Supply Voltage accuracy	VINT	±0.1	V	Supply voltage is measured internal to the transceiver and can, with less accuracy, be correlated to the voltage at the Vcc pin. Valid over $3.3V \pm 5\%$
Transmitter Laser DC Bias Current				
Accuracy	lint	±10	%	
Transmitted Average Optical				Coupled into fiber.
Output Power Accuracy	Рт	±3.0	dB	Valid from -1dBm to -10dBm
Received Average Optical Input				Coupled from fiber
Power Accuracy	Pr	±3.0	dB	Valid from -24 dBm to - 1 dBm

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

1211 AIR WAY · GLENDALE, CA 91201-2497 · TEL: 818-247-6000 · FAX: 818-500-9912

www.glenair.com PAGE 15 of 18 E-mail: sales@glenair.com

GLENAIR, INC.




### **ACCESSORIES**

### Fiber Optic Jumper Cables to support connection to Mil/Aerospace Connectors

### **KEY FEATURES:**

- Jumper cable between Glenair Transceiver (end A) and Mil/Aero Connector termini (End B)
- Offered with either Multimode and Single Mode fibers

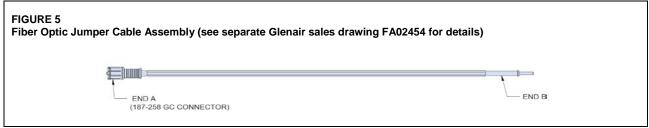

### PCB Threaded Inserts, PN 059-0007

### **KEY FEATURES**

- Simplifies installation of PCB Mount transceivers eliminating the need for washers and nuts
- Soldered to PCB to eliminate need for handling nuts during assembly
- Existing Options to support PCB thickness from 0.03" to 0.92"
- Can support thicker PCB if required

**EVALUATION Boards, PN 050-329** 

GLENAIR, INC.

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA

· TEL: 818-247-6000

· FAX: 818-500-9912

www.glenair.com PAGE 16 of 18 E-mail: sales@glenair.com



### Recommended Inspection & Cleaning Tools/Kits

The following recommendations are suggested for the 050-341 PCB Mount Single Fiber BIDI Transceiver:

- GBS-1001 Inspection Kit (Includes GIT-003 which is a universal 1.25mm tip)
- GCLT-H125 or GCLT-HA125 cleaning tool

GLENAIR, INC.

1211 AIR WAY · GLENDALE, CA 91201-2497 · TEL: 818-247-6000 · FAX: 818-500-9912

www.glenair.com PAGE 17 of 18 E-mail: sales@glenair.com



Recommended Inspection & Cleaning Tools/Kits – (Continued)

- A simple push motion engages tool
- Audible click when tool is fully engaged
- Durable over 525 engagements per tool
- Crush resistant to over 250N
- Impact resistant to survive drops over 1.5M

©2016 Glenair, Inc. REV: 16 US Cage Code 06324 Printed in USA