



770-031 Right Angle Heat Shrink Boot

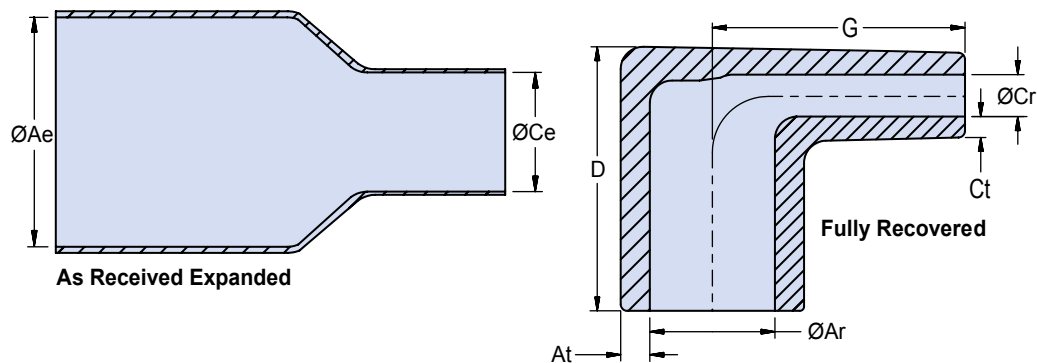
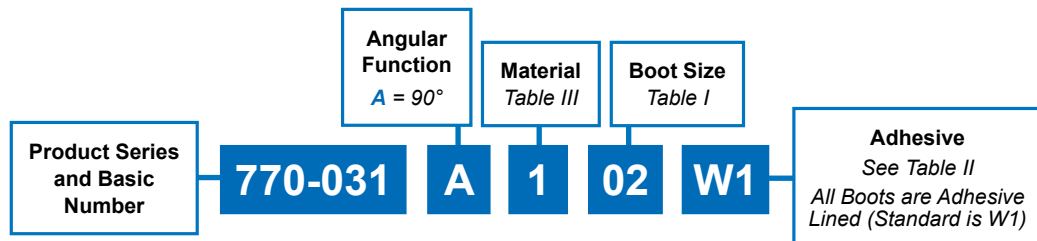


TABLE I: Boot Size and Shrink Boot Dimensions

Boot Size	Glenair US Part Marking (Engraved on Boot)	Ae Min Dia	Ar Max Dia	At ± 10%	Ce Min Dia	Cr Max Dia	Ct ± 10%	G ± 10%	D ± 10%
01	SF1A	.370 (9.40)	.160 (4.06)	.040 (1.02)	.180 (4.57)	.045 (1.14)	.030 (0.76)	.300 (7.62)	.380 (9.65)
02	SF2A	.370 (9.40)	.200 (5.08)	.045 (1.14)	.180 (4.57)	.065 (1.65)	.031 (0.79)	.375 (9.53)	.395 (10.0)
03	SF3A	.560 (14.2)	.260 (6.60)	.050 (1.27)	.370 (9.40)	.095 (2.41)	.035 (0.89)	.440 (11.20)	.469 (11.9)


TABLE II: Glenair Series 77 Boots Adhesive Types

Attribute	W1 Standard High Temperature Hot Melt Adhesive	W2 Hot Melt Adhesive	R High Performance Epoxy Adhesive
Boot Material Compatibility	Type 1, 2, 5, 6 and 7	Type 1, 2, 3 and 7	Type 1, 2, 5 and 6
Continuous Operating Temp.	-55° to +125°C	-40° to +80°C	-75° to +150°C
Resistance to Fuels, Oils & Fluids	Good	Good	Excellent
Low Toxicity, Zero Halogen	Yes	Yes	Yes

TABLE III: Shrink Boot Materials

No.	Compound	Material Description
1	2025	High Performance Elastomer*
2	2010	Zero Halogen Polyolefin*

* Other Materials available

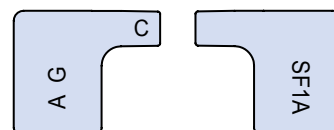

Boots are marked with manufacturer's identification and part number